


J DECK UPPER DECK DRIVE BELT REPLACEMENT (122 cm THREE BLADE REAR DISCHARGE DECK)



1. Place belt on right hand spindle pulley drag remainder of belt out to left side of machine.



2. Hold open belt loop in left hand, palm uppermost.

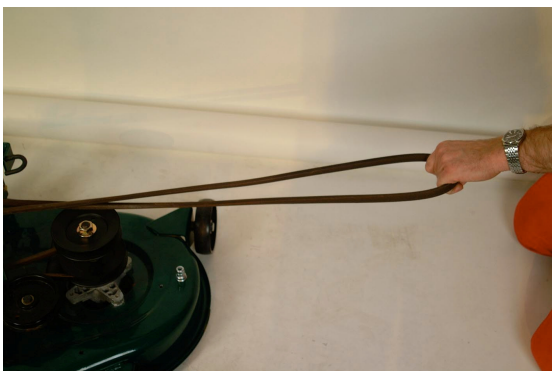


3. Rotate hand 180° clockwise. This gives an upper & lower fall on the belt.




4. Place upper fall around upper pulley. (Left hand spindle pulley.)



5. From the front of the left spindle pulley, follow the belt around the adjacent flat idler pulley.

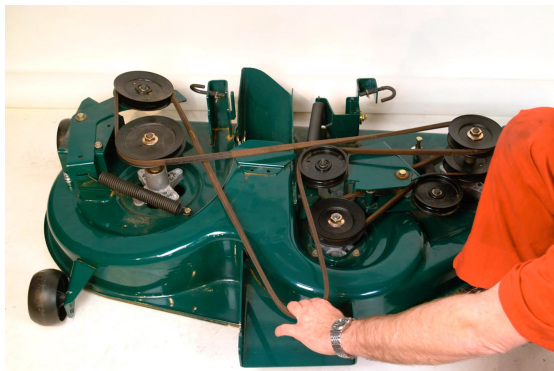

6. Drag the belt from the rear of the right spindle pulley and place it around the right hand idler pulley.

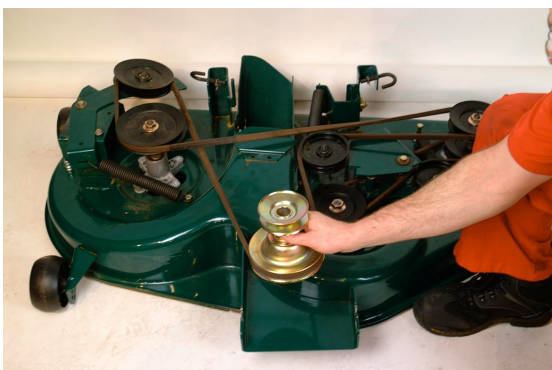

7. Place remainder of belt around engine pulley.

Note

For clarity, the belt guards and right hand idler pulley belt keeper have been removed to illustrate the above procedure. Although it is not necessary to remove the guards in practice, the keeper must be removed to prevent having to force the belt past it.

